

kaise



DIGITAL PROBE TESTER
INSTRUCTION MANUAL

SK-6592

KAISE CORPORATION

FOR SAFETY MEASUREMENTS!!

Prior to use, to avoid an electrical shock hazard to the operator and/or damage to the instruments, read carefully the WARNINGS with the symbol listed in 「4. SAFETY PRECAUTIONS」, 「5. MEASUREMENT PROCEDURES」 and 「6. MAINTENANCE」 of this instruction manual.

Important Symbols

- The symbol listed in IEC 61010-1 and ISO 3864 means "Caution (refer to instruction manual)".
- WARNING** : The symbol in this manual advises the user of an electrical shock hazard that could result in serious injury or even death.
- CAUTION** : The symbol in this manual advises the user of an electrical shock hazard that could cause injury or material damages.

WARNING

SK-6592 is designed to comply with CAT III 600V. But, do not measure High Power Line of more than 6kVA power. High Power Line sometimes includes High Surge Voltage that could possibly induce dangerous arcs of explosive short in the instrument and could result in serious injury to the operator. Even if it is Low Power Line, use extreme care when measuring high voltage.

INTRODUCTION

Thank you for purchasing KAISE "MODEL SK-6592 Digital Probe Tester". To obtain the maximum performance of this instrument, read this Instruction Manual carefully, and take safe measurement.

1. UNPACKING AND SPECIFICATIONS

Inspect the instrument and accessories for transport damage. If any damage or missing items are found, ask your local dealer for replacement.

Confirm that the following items are contained in the package.

- Digital Probe Tester
- One 3V CR2032 Battery (installed)
- Carrying Case
- Instruction Manual

2. SPECIFICATIONS

2-1. GENERAL SPECIFICATIONS

- DISPLAY (LCD)**
 - Numerical Display : 4000 count LCD, 8mm high.
 - Units and Symbols : mV, V, Hz, %, Ω , k Ω , M Ω , nF, μ F, \rightarrow , \leftarrow , DIFF, MAX, MIN, BAT, DH, OL, AUTO, APO, \equiv , \sim , \rightarrow and decimal point.
- OPERATING PRINCIPLE** : Σ/Δ conversion
- RANGE SELECTION** : Autoranging
- SAMPLING RATE** : 3 times per second
- POLARITY** : Autopolarity, "-" symbol when minus
- OVERRRANGE INDICATION** : "OL" symbol appears. (excluding DC/AC 600V)
- DISPLAY HOLD / DIFF (Zero Adjustment)** :
 - Press DH / DIFF Key for less than 0.5 second \rightarrow DISPLAY HOLD
 - Press DH / DIFF Key for more than 1 second \rightarrow Difference Measurement
 - Press DH / DIFF Key for more than 1 second same as above before measuring Capacitance \rightarrow Zero Adjustment
- MAX / MIN Value** : When measuring \equiv V, \sim V, Ω , press SHIFT Key for more than 1 second.
- BATTERY WARNING** : BAT symbol appears when battery voltage goes down below approx. 2.4V.
- OPERATING TEMPERATURE & HUMIDITY** : 0°C to 40°C, less than 80%RH in non-condensing.

①

②

③

④

- STORAGE TEMPERATURE & HUMIDITY** : -20°C to 60°C less than 80% RH in non-condensing.
- POWER SUPPLY** : One 3V CR2032 Battery.
- POWER CONSUMPTION** : 4.5mW typically.
- BATTERY LIFE** : 70 hours continuous operation.
- AUTO POWER OFF** : Power turns off automatically in 15 minutes after any switch operation.
- DIELECTRIC STRENGTH** : 5.55kV rms for one minute between Input Terminal and Cases.
- OVERLOAD PROTECTION** :
 - V : 900V DC or AC rms max. for 1 minute. (400mV Range is 600V rms)
 - Ω / \rightarrow / \leftarrow / \rightarrow : 300V rms max. for 1 minute.
- DIMENSIONS & WEIGHT** : 179(H) x 28(W) x 20(D)mm, 60g
- SAFETY LEVEL** : IEC-61010-1 Overvoltage CAT. III 600V and EMC Test passed.
- ACCESSORY** : One Black Test Lead, Battery (Installed), Carrying Case, Instruction Manual
- OPTIONAL ACCESSORY** : 940 Alligator Clips.

2-2. MEASUREMENT SPECIFICATIONS

(23°C \pm 5°C, less than 80% RH in non-condensing)

1. DC Voltage (\equiv V)

Range	Accuracy	Resolution	Input Impedance	Max Input Voltage	Overload Protection
400.0mV	$\pm 0.5\%rdg \pm 3dgt$	100 μ V	$\approx 100M\Omega$	600V DC	900V rms for 1 minute
4.000 V		1mV	$\approx 11M\Omega$		
40.00 V	$\pm 1.0\%rdg \pm 3dgt$	10mV	$\approx 10M\Omega$	600V rms	900V rms for 1 minute
400.0 V		100mV			
600 V		1 V			

2. AC Voltage (\sim V)

Average Rectification

Range	Accuracy	Resolution	Input Impedance	Max Input Voltage	Overload Protection
4.000 V	$\pm 1.5\%rdg \pm 5dgt$	1mV	$\approx 11M\Omega$	600V rms	900V rms for 1 minute
40.00 V		10mV	$\approx 10M\Omega$		
400.0 V		100mV			
600 V		1 V			

Frequency Response : 50Hz~400Hz

3. Frequency (Hz)

Range	Accuracy	Resolution	Input Sensitivity	Max. Input Voltage
1.000Hz	$\pm 0.2\%rdg \pm 2dgt$	0.001Hz	3V RMS	600V rms or 2 X 10 ⁶ VHz
~100.0kHz		~100Hz		

4. Duty Cycle (%)

Range	Accuracy	Resolution	Input Sensitivity	Max. Input Voltage	Frequency Scope
0.0%	$\pm 0.5\%rdg \pm 5dgt$	0.1%	<10KHz : 3V RMS	600V rms	1Hz~1kHz
~99.9%			$\geq 10KHz$: no Spec.		

5. Resistance (Ω)

Range	Accuracy	Resolution	Test Current	Open Circuit Voltage	Overload Protection
400.0 Ω	$\pm 1.5\%rdg \pm 4dgt$	0.1 Ω	$\leq 0.2mA$	$\approx 0.44V$	300V rms
4.000k Ω		1 Ω	$\leq 50 \mu A$		
40.00k Ω	$\pm 1.0\%rdg \pm 3dgt$	10 Ω	$\leq 5 \mu A$	$\approx 0.44V$	300V rms
400.0k Ω		100 Ω	$\leq 0.5 \mu A$		
4.000M Ω	$\pm 5.0\%rdg \pm 3dgt$	1 k Ω	$\leq 50nA$	$\approx 0.44V$	300V rms
40.00M Ω		10 k Ω			

6. Continuity Tests (\rightarrow)

Range	Buzzer Sound	Response Time	Open Circuit Voltage	Overload Protection
400.0 Ω	less than 60 Ω	1m sec	$\approx 0.44V$	300V rms

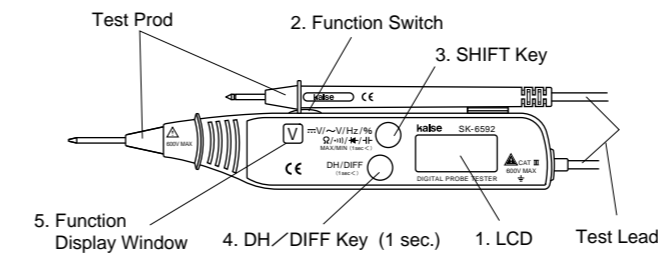
7. Diode Tests (\leftarrow)

Range	Accuracy	Open Circuit Voltage	Test Current	Overload Protection
1.000V	$\pm 5.0\%rdg \pm 3dgt$	$\leq 1.7V$	$\leq 0.7mA$	300V rms


8. Capacitance (\rightarrow)

Range	Resolution	Accuracy	Test Voltage	Overload Protection
50.00nF	10pF	$\pm 5.0\%rdg \pm 10dgt$	$\leq 1.7V$	300V rms
500.0nF	100pF			
5.000 μ F	1nF			
50.00 μ F	10nF			
100.0 μ F	100nF			

3. NAME ILLUSTRATION



3-1. LCD



- \equiv : Direct Current (DC) on Voltage
- \sim : Alternating Current (AC) on Voltage
- : Minus symbol automatically shown when polarity is minus.
- APO : Auto Power Off
- AUTO : Autoranging
- BAT : Battery Warning
- DH : Display Hold
- DIFF : Difference Measurements
- MAX : Maximum Value Measurements
- MIN : Minimum Value Measurements
- \rightarrow : Continuity Tests
- \leftarrow : Diode Tests
- mV, V : Units of Voltage
- Hz : Frequency
- % : Duty Cycle
- Ω , k Ω , M Ω : Units of Resistance
- nF, μ F : Units of Capacitance

3-2. Function Switch

Set FUNCTION Switch to a desired position of \rightarrow or \leftarrow position and to OFF position when measurements are finished. \rightarrow position measures AC/DC Voltage, Frequency, Duty Cycle. \leftarrow position measures Resistance, Continuity Test, Diode, Capacitance.

3-3. SHIFT Key

Each press of this Key for less than 0.5 second works in the following order.

\rightarrow : \equiv V \rightarrow \sim V \rightarrow Hz \rightarrow % \rightarrow \equiv V ...circulates.

\leftarrow : Ω \rightarrow \rightarrow \leftarrow \rightarrow \rightarrow \rightarrow \rightarrow \rightarrow ...circulates.

MAX / MIN : When measuring \equiv V, \sim V or Ω , press SHIFT Key for more than 1 second. MAX /MIN symbol appears on LCD and MAX /MIN measurement starts. To cancel this function, press this Key again for more than 1 second and MAX/MIN symbol disappears.

3-4. DH / DIFF Key

1. DISPLAY HOLD

Press DH / DIFF Key for less than 0.5 second to hold display. DH symbol shows on LCD. To cancel this function, press this Key again and DH symbol disappears.

NOTE: This function is not available for Hz Measurement.

2. Difference Measurement

When measuring functions except Hz (Frequency), % (Duty Cycle), Press DH / DIFF Key for more than 1 second, DIFF symbol shows on LCD. When measuring a value or applying desired value into the instrument, press DH / DIFF Key for more than 1 second and input value is stored and converted to read 0 \pm 1 digit on LCD with DIFF symbol displayed. The difference between the stored value and a measuring value is displayed on LCD with proceeding measurements.

Input Value = Xo, Measuring Value proceeding = Xn, Difference = Xn - Xo

The stored Input Value is renewed with each press of DIFF Key. To cancel this function, press this Key for more than 1 second again and DIFF symbol disappears.

3. Zero Adjustment

When measuring Capacitance, if LCD doesn't show ZERO value, press DH / DIFF Key for more than 1 second to make Zero Adjustment.

3-5. Function Display Window

A function being selected is displayed in this window. Also, see the symbol displayed on LCD.

4. SAFETY PRECAUTIONS


Correct knowledge about electric measurements is necessary because electric measurement is sometimes a very dangerous work.

To eliminate possibility of injury to the operator and damage to the instrument, the following precautions and measurement procedures must be taken. Mis-use, abuse and carelessness cannot be prevented by any written word and is fully the operator's responsibility. Observing the following warnings and cautions, take safe measurements.

4-1. WARNINGS

WARNING 1. Checks of Body and Test Lead

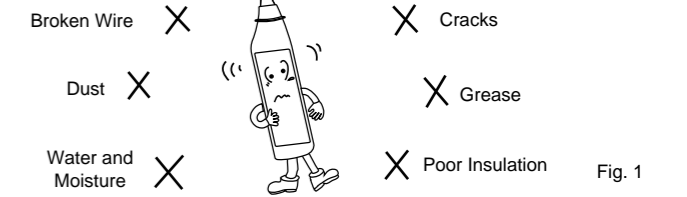Before every measurement, do not fail to confirm that the body of this instrument and handle insulator of the attached Test Prod have no cracks nor any other damage on them. Make sure that the body and the handle insulator are free of dust, grease and moisture.



WARNING 2. Measurement of High Power Line Prohibited

Do not measure with this instrument High Power Line (High Energy Circuits) more than 6kVA power such as Distribution Transformers, Bus Bars, Power Line for Big Motors, etc. High Power Line is very dangerous as it sometimes includes High Surge Voltage that will induce short in the instrument and results in shock hazard. Use the special instrument designed to measure High Power Line.

WARNING 3. Cares of High Voltage Measurements

Even if Low Energy Circuits of electric/electronics appliances, heating elements, small motors, line cords and plugs, etc., High Voltage Measurements are very dangerous. Do not touch the instrument, its Test Leads or any part of the circuit while it is on.

Generally, shock hazard shall be exist at any part involving a potential in excess of 30V rms or 42.4V DC or peak and where a leakage current from that part to ground exceeds 0.5mA.

WARNING 4. Safety Measurement Procedure

When measuring a circuit that will possibly include dangerous voltage, keep strictly the following measuring procedures.

- Before measurement, turn off power to the circuit to be measured.
- Attach Black Alligator Clip (optional) to Black Test Prod and Red Alligator Clip (optional) to Red Test Prod of Probe Tester.
- Set FUNCTION Switch to V position and select \equiv V or \sim V by pressing SHIFT Key.
- Confirm that the power of the circuit to be measured is OFF. Then, connect Black Alligator Clip to - (earth) side and Red Alligator Clip to + (positive) side of the circuit to be measured.
- Do not touch Test Prod and Probe Tester with your hands. Also, take safety distance from the power source or the circuit to prevent any part of your body from touching high voltage.
- Turn on power to the circuit to be measured and read the voltage on LCD.
- Turn off power to the circuit being measured and discharge all capacitors in the circuit.
- Disconnect Alligator Clips of Test Prods from the circuit.

In case you want to measure live line, observe the following procedure.

- Set FUNCTION Switch to V position and select \equiv or \sim V by SHIFT Key.
- Take safety distance from the power or the circuit to be measured to prevent any part of your body from touching dangerous voltage.
- Attach Black Alligator Clip to Black Test Prod. Then, connect Black Alligator Clip to - (earth) side of the circuit to be measured.
- Hold the Probe Tester with one hand and connect the Test Prod to + (positive) side of the circuit to be measured.
- Read the voltage on LCD. Refer to the figure.2

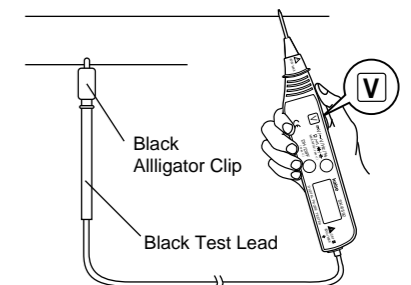



Fig. 2

⚠ WARNING 5. Correct Selection of FUNCTION Switch

When making measurements, always confirm that FUNCTION Switch is set to correct position. Measuring voltage on  position will cause serious damage to the instrument.

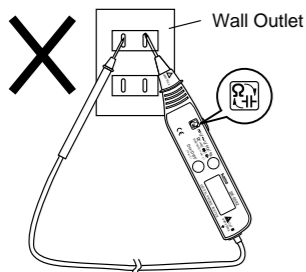


Fig. 3

⚠ WARNING 6. Maximum Input Observance

Do not attempt to measure voltage that might exceed the specified maximum voltage of this instrument.

⚠ WARNING 7. Test Prod Disconnection

Prior to changing FUNCTION Switch to another function during measurements, or opening Battery Case for replacement of battery, always disconnect Test Prods of Probe Tester from the circuit being measured.

4-2. GENERAL WARNINGS AND CAUTIONS

⚠ WARNINGS

- Do not let the children use the instrument or those people who are unable to recognize the dangers of electric measurements.
- Do not make electric measurements in a naked or barefooted state. This will give electric shock hazard to the operator.
- The points of Test Prods are sharp and dangerous. Do not get hurt with them.

⚠ CAUTIONS

- Do not polish the meter case, or attempt to clean it with any cleaning fluid, gasoline, benzine, etc. If necessary, use silicon oil or antistatic fluid.
- Avoid severe mechanical shock or vibration, extreme temperature or very strong magnetic field.
- Remove the battery when not in use for an extended time since the exhausted battery might leak electrolyte and corrode the internal components.

5. MEASUREMENT PROCEDURES

5-1. PREPARATION FOR USE

1. INSTRUCTION MANUAL

Prior to use, read INSTRUCTION MANUAL carefully and acquaint yourself with the specifications and functions of the instrument. Especially, read and observe strictly the 「4. SAFETY PRECAUTIONS」.



2. BATTERY

One 3V CR2032 battery is installed in this instrument. When battery is consumed and BAT symbol is shown on LCD, unscrew the mounting screw of Battery Case Lid and remove the lid. Then, replace the battery with fresh one and place the battery in correct polarity. Refer to 「6-2. BATTERY REPLACEMENT」.

3. TEST PRODS

Connect Black Test Prod to - (earth) side of the circuit and Red Test Prod of Probe Tester to + (high potential) side of the circuit being measured.

4. POWER ON

Set FUNCTION Switch to  or  position to turn on power. All segments appear on LCD for 1 sec. In case that LCD is not turned on, battery contacts might be bad, battery might be set in the wrong polarity or might be worn out. Take necessary action. Do not fail to turn off power after measurements.

5. OVERRANGE INDICATION



OVERRANGE INDICATION does not show on Voltage measurements, even if voltage value exceeds 600V. On Resistance range, OL symbol is displayed on LCD when ohm value is infinite.

⚠ WARNING : To avoid injury to the operator and/or damage to the instrument, do not make measurements that might exceed 600V, the maximum input voltage.

6. AUTORANGING

When Voltage, Resistance or Capacitance measurement is made, range is selected automatically. AUTO symbol is shown on LCD. When making Diode and Continuity Tests, autoranging does not work as they consist of only one range.






7. AUTO POWER OFF

After 15 minutes of last operation with FUNCTION Switch or Keys, LCD turns off automatically. This function prevents battery consumption when power off is forgotten. When continuous measurements more than 15 minutes are necessary, set FUNCTION Switch to  or  position with SHIFT Key pressed on for less than one second, or press MAX/MIN Key.

In this case, APO symbol is not displayed on LCD and Auto Power Off does not work during measurements.

8. SYMBOL MARK






The following symbols shown on the instrument and in the instruction manual are listed in IEC 61010-1 and ISO 3864.

-  : Caution (refer to instruction manual).
-  : Direct Current (DC)
-  : Alternating Current (AC)
-  : Earth (Ground)
-  : Double Insulation

5-2. VOLTAGE, FREQUENCY, DUTY CYCLE (V / V / Hz / %) MEASUREMENTS

⚠ WARNING

Do not measure High Power Line of more than 6kVA power with this instrument. Maximum Input Voltage of Voltage Function is 600V. Do not measure voltages that might exceed 600V to avoid electrical shock hazard and/or damage to the instrument. Prior to use, read carefully 「4. SAFETY PRECAUTIONS」 of this instruction manual.

1. Set FUNCTION Switch to  position.
NOTE : Under this no input condition, random numerals may appear on LCD. This phenomena is caused by high internal resistance of the instrument and not the trouble.
2. Press SHIFT Key to select  V or  V.
3. Connect Black Test Prod to - (earth) side and Red Test Prod of Probe Tester to + (High potential) side of the circuit to be measured.
NOTE : For safety measurements, connect Alligator Clips (optional) to Test Prods of Probe Tester.
NOTE : When taking voltage measurements, always connect the instrument **IN PARALLEL** with the circuit being measured.
4. Read the voltage on LCD.
5. **Hz and % :** When measuring  V or  V, press SHIFT Key to measure Hz (Frequency) and press this Key again to measure % (Duty Cycle). Each press of this Key works in the following order.
 $\text{---V} \rightarrow \sim\text{V} \rightarrow \text{Hz} \rightarrow \% \rightarrow \text{---V} \dots$ circulates.
MAX/MIN : Press SHIFT Key for more than 1 second to make MAX/MIN measurements. To cancel this key, press it again for more than 1 second.
6. **DH/DIFF Key :** Press this key for less than 0.5 second to hold display. Press this Key for more than one second to make Difference Measurements.
7. After measurements, set FUNCTION Switch to OFF position.

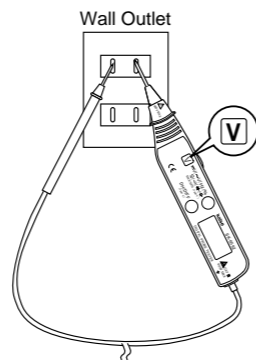




Fig. 4

5-3. RESISTANCE (Ω) MEASUREMENTS

⚠ WARNING

Do not measure Voltage on  position. This will cause electrical shock hazard to the operator and/or damage to the instrument. Before taking any in-circuit resistance measurements, remove power to the circuit being tested and discharge all capacitors in the circuit.

1. Set FUNCTION Switch to  position.
2. When taking any in-circuit resistance measurements, remove power to the circuit being tested and discharge all capacitors in the circuit. Open one side of the resistor to be measured.
3. Connect Test Prods of Probe Tester to the resistor being measured.
4. Read the resistance on LCD.
5. **MAX/MIN, DH/DIFF Keys :** These Keys are available same as in Voltage Measurements.
6. After measurements, set FUNCTION Switch to OFF position.

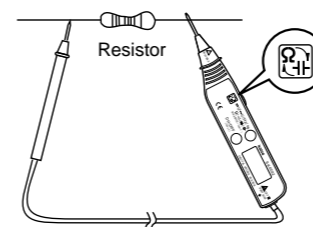





Fig. 5

5-4. CONTINUITY () TESTS


⚠ WARNING




Do not measure Voltage on  position. This will cause electrical shock hazard to the operator and/or damage to the instrument. In case continuity test is made, turn off power to the circuit being measured and discharge all capacitors in the circuit.

1. Set FUNCTION Switch to  position.
2. Press SHIFT Key 1 time to display  on LCD.
3. Turn off power to the circuit and discharge all capacitors in the circuit.
4. Connect Test Prods of Probe Tester to the circuit to be tested. Buzzer sounds when the resistance value is less than approx. 60 Ω .
5. When measurements are finished, remove Test Prods from the circuit and set FUNCTION Switch to OFF position.

5-5. DIODE () TESTS

⚠ WARNING

Do not measure Voltage on  position. If the diode is connected in a circuit, turn off power to the circuit and discharge all capacitors in the circuit. Disconnect one side of the diode and test it.

1. Set FUNCTION Switch to  position.
2. Press SHIFT Key 2 times to select  .
 symbol appears on LCD.
3. If the diode is connected in a circuit, turn off power to the circuit and discharge all capacitors in the circuit and disconnect one side of diode from the circuit.
4. Connect Black Test Prod to Anode and Red Test Prod to Cathode of the diode being measured. This is Reverse Connection. Confirm that the LCD displays OL symbol. Refer to the figure 6.
5. Reverse Test Prod connection to the diode being tested. This is Forward Connection. In case of Silicon diodes, LCD displays 0.4V to 0.7V, Germanium diodes, 0.1V to 0.4V, and the diodes are judged good.
6. When measurements are finished, remove Test Prods from the diode and set FUNCTION Switch to OFF position.

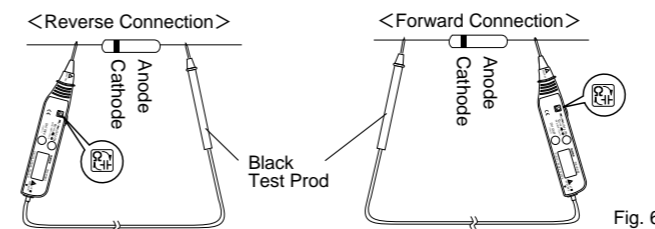




Fig. 6

5-6. CAPACITANCE () MEASUREMENTS

⚠ WARNING

Do not measure Voltage on  position. That will cause electrical shock hazard to the operator and damage to the instrument. Before taking Capacitance measurements, remove power to the circuit being measured and discharge all capacitors.

1. Set FUNCTION Switch to  position.
2. Press SHIFT Key 3 times to display nF unit on LCD.
3. Press DIFF Key for more than 1 second to display 0 \pm 2digit on LCD in case it shows more digits.
4. Remove power to the circuit being tested and discharge all capacitors in the circuit.
5. Connect Test Prods of Probe Tester to the capacitor being measured.
6. Read capacitance on LCD.
7. After measurements, set FUNCTION Switch to OFF position.

6. MAINTENANCE

6-1. WARRANTY STATEMENT

The warranty statement for the Digital Probe Tester of Model SK-6592 is printed in the last part of this manual. Read it carefully before requesting a warranty repair.

6-2. BATTERY REPLACEMENT

⚠ WARNING

To avoid electrical shock hazard and/or damage to the instrument, turn off power and disconnect Test Prods before removing Battery Case Lid.

1. If the battery is consumed and BAT symbol is shown on LCD, replace the battery.
2. Remove Battery Case Lid by unscrewing the mounting screw.
3. Replace the consumed battery with a fresh 3V CR2032 battery. Be careful of the battery polarity, +side up.
4. Replace Battery Case Lid and screw the mounting screw.

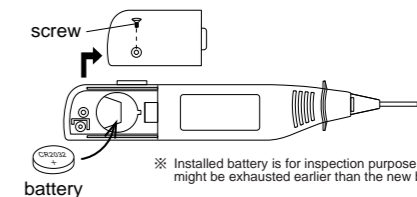


Fig. 7

6-3. PERIODICAL CHECK AND CALIBRATION

Periodical check and calibration are necessary to make safety measurements as well as to maintain the specifications.

It is recommended that the instrument may be checked and calibrated once each year and/or after it is repaired. Periodical Check and Calibration Services are available at KAISE AUTHORIZED SERVICE AGENCY through your local dealer at a cost basis charge.

Pack the instrument securely in its original carton together with descriptions of your name, address, telephone number and the service required, and ship prepaid to your local dealer.

6-4. REPAIR

Repair service, warranty or non-warranty, is available at KAISE AUTHORIZED SERVICE AGENCY through your local dealer. Warranty repair is executed free of charge, but, non-warranty repair is charged on the cost basis.

Pack the instrument securely in its original package together with descriptions of your name, address, telephone number, problem encountered and the service required, and ship prepaid to your local dealer.

When the instrument does not operate properly, the following steps should be taken before returning the instrument for repair, warranty or non-warranty.

1. Check the battery connection.
2. Check the battery if it is installed in the correct polarity. + side must be up.
3. Check the battery if it is alive and usable.
4. Make sure that FUNCTION Switch and SHIFT Key are selected correctly.
5. Make sure that input voltage is within maximum input value on each function.
6. Make sure that the body of this instrument and the Test Prods have no cracks nor any other damage on them.
7. Be careful of noise from the equipment under test or the ambient environment in which the instrument is being used. The instrument is fully shielded against noise, but may read error due to very strong noise.

WARRANTY

SK-6592 is warranted in its entirety against any defects of material or workmanship under normal use and service within a period of one year from the date of purchase of the original purchaser. Warranty service is available at **KAISE AUTHORIZED SERVICE AGENCY** through your local dealer. Their obligation under this warranty is limited to repairing or replacing SK-6592 returned intact or in warrantable defect with proof of purchase and transport charges prepaid. **KAISE AUTHORIZED DEALER** and the manufacturer, **KAISE CORPORATION**, shall not be liable for any consequential damages, loss or otherwise. The foregoing warranty is exclusive and in lieu of all other warranties including any warranty of merchantability, whether expressed or implied. This warranty shall not apply to any instrument or other article of equipment which shall have been repaired or altered outside of **KAISE AUTHORIZED SERVICE AGENCY**, nor which have been subject to misuse, negligence, accident, incorrect repair by users, or any installation or use not in accordance with instructions provided by the manufacturer.

KAISE AUTHORIZED DEALER

KAISE CORPORATION

422 Hayashinogo, Ueda City, Nagano Pref., 386-0156 Japan
TEL : +81-268-35-1600 (REP.) / FAX : +81-268-35-1603
E-mail : sales@kaise.com
http://www.kaise.com

Product specifications and appearance are subject to change without notice due to continual improvements.